

TECHNICAL BULLETIN FROM SPECTRA WATERMAKERS

FROM: Technical Support
Spectra Watermakers
20 Mariposa Rd
San Rafael, CA 94903

TO: ALL Spectra Watermakers Distributors

RE: Newport 700 and 1000 Mk II Feed Pumps

Due to some manufacturing defects in the stainless steel inner magnet barrier can on Newport 700 and 1000 Mk II feed pump we have experienced several field failures caused by a hairline crack in the barrier can on the feed pump.

Systems shipped Prior to October 2009 may have a weakened inner magnet barrier can on Newport 700 and 1000 MkII systems. This issue can be resolved by exchanging the rigid high pressure tubing on the pressurized feed water supply for a Spectra supplied high pressure hose assembly, p/n SUB-NP-MK2-ILHA.

Please retrofit any Newport 700 or 1000 MkII system using the rigid high-pressure tubing between the feed pump and the Clark Pump, as soon as it is conveniently possible. Contact Technical Support at Spectra Watermakers to obtain the retrofit hose assembly, p/n SUB-NP-MK2-ILHA, as a warranty replacement part. We suggest that you keep several retrofit kits on hand. The retrofit process is quite simple and could be easily done by the yacht owner. No special tools are required.

This problem only affects the *Newport 700 and 1000 MkII* models and does NOT affect any of the Mk I series watermakers. Please contact Tech Support at 415-526-2780 with any questions or concerns regarding this matter.